
Wiring Diagram

WARNING: *DO NOT SERVICE WHILE ENERGIZED!*

MT-ATX-ZZ-480D-112.5KVA-480Y.277-N3R

Primary Voltage: 480V Delta
Secondary Voltage: 480Y/277 V Wye-N

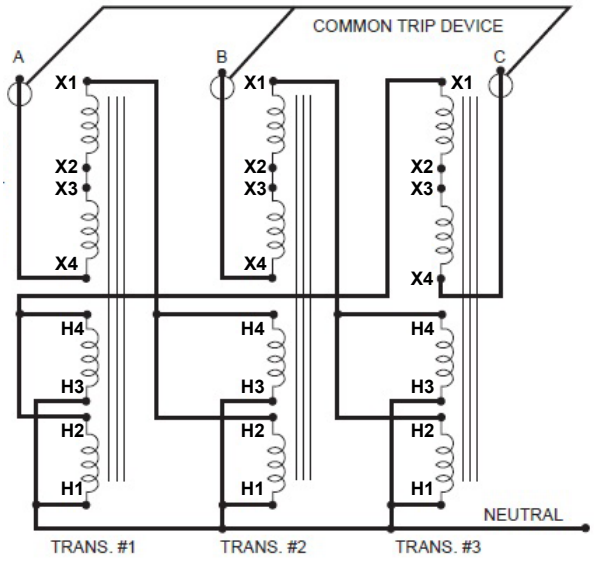

Connection Guide

1. Connect **X2** and **X3** together for each transformer
2. Connect **X1** from **Trans. #1** to **H4** and **H2** on **Trans. #2**
3. Connect **X1** from **Trans. #2** to **H4** and **H2** on **Trans. #3**
4. Connect **X1** from **Trans. #3** to **H4** and **H2** on **Trans. #1**
5. Connect **H3** and **H1** together and bridge between all three trans. for Neutral
6. Connect High Voltage 480V **Phase A** to **X4** on **Trans. #1**
7. Connect High Voltage 480V **Phase B** to **X4** on **Trans. #2**
8. Connect High Voltage 480V **Phase C** to **X4** on **Trans. #3**
9. Connect Low Voltage 277V using **Phase A** and **Neutral**
10. Connect Low Voltage 277V using **Phase B** and **Neutral**
11. Connect Low Voltage 277V using **Phase C** and **Neutral**

LARSON ELECTRONICS LLC • 9419 E US HWY 175 • KEMP, TX 75143
p: 1-800-369-6671 • intl: 903-498-3363 • f: 903-498-3364 • sales@larsonelectronics.com