



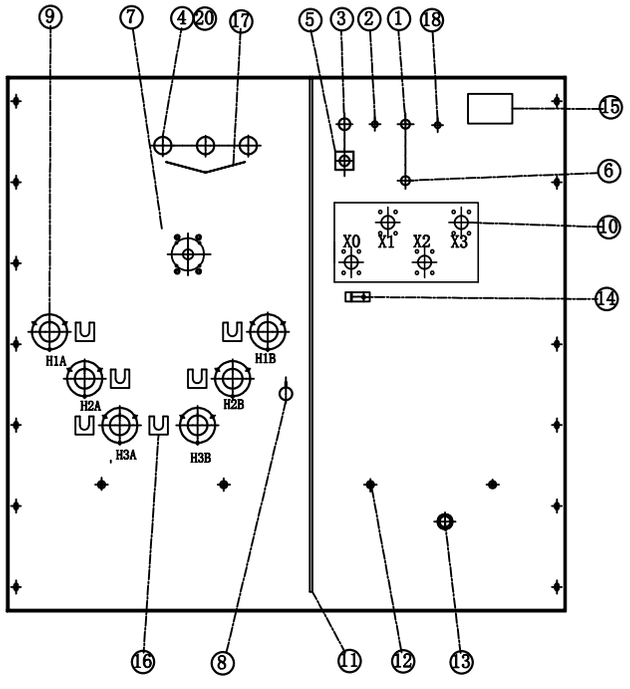


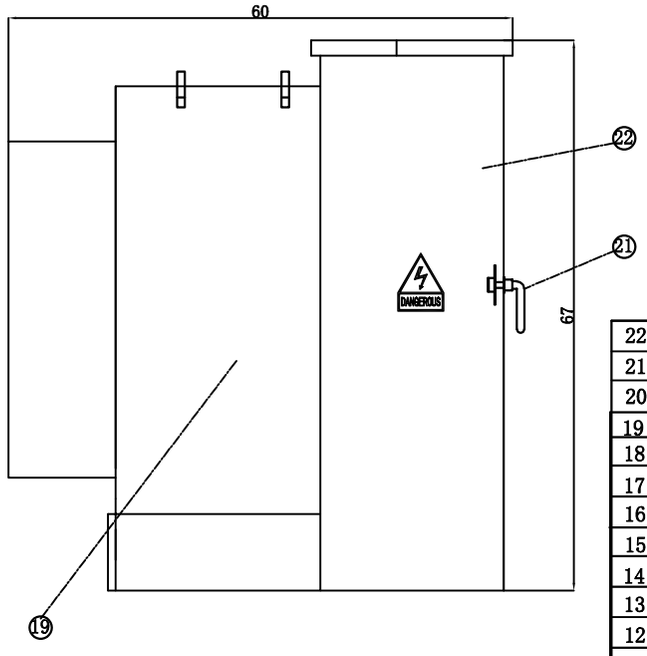

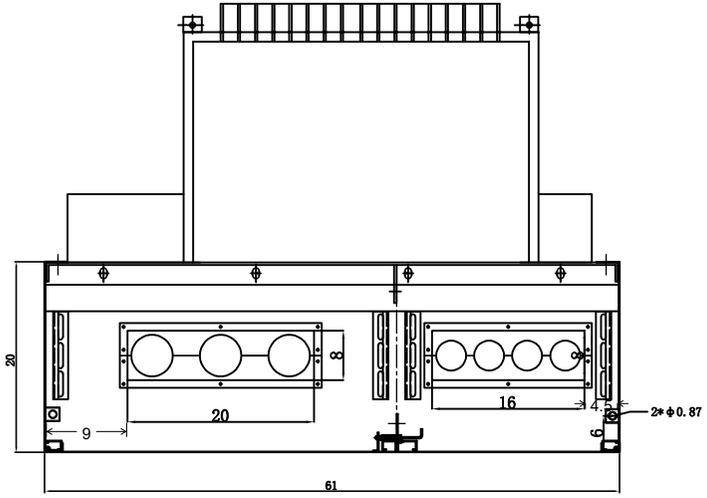

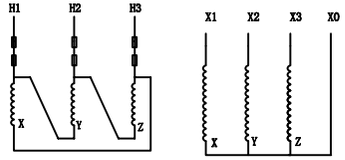

WIRING CONNECTION

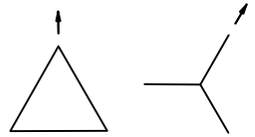

PHASOR DIAGRAM

Approx. Weight: 5295LBS.

No.	Name	Model	QTY	Material	Remark
22	tank&housing	ANSI gray			
21	padlock	penta-head bolt	1		
20	current limting fuse		3		with Bayonet fuse
19	insulation oil	Biodegradable oil			
18	gas sampler valve		1		Schrade Valve
17	drip shield		1		
16	parking stand		6		
15	nameplate		1		
14	grounding strap		1		
13	drain valve w/sampler		1		
12	grouding lug	Ø25*20, M10	4		with copper bar
11	reinforcing rib	8mm steel	1		
10	LV bushing		4		4-hole spade
9	HV bushing	200A well&insert	6	load break	with (3) arrsters
8	off-circuit tap changer		1		
7	load breaker switch		1		4-position
6	temperature indicator		1		
5	oil indicator		1		
4	Bayonet fuse		3		w/flapper valve
3	oil fill valve		1		
2	pressure relief valve		1		automatic action
1	pressure indicator		1		

225kVA, 60Hz, KNAN,
34500V, Delta, Pri.,
480Y/277V, Wye-N

3P Pad Mounted Transformer

mark	revise	revision	signature	date
designed			standard	
checked			examined	
audited			approved	
crafted			date	

pattern mark				weight	scale

total page | page

LARSON ELECTRONICS®

Remark: dimensions here are in inches.Only for approval/preliminary design..