



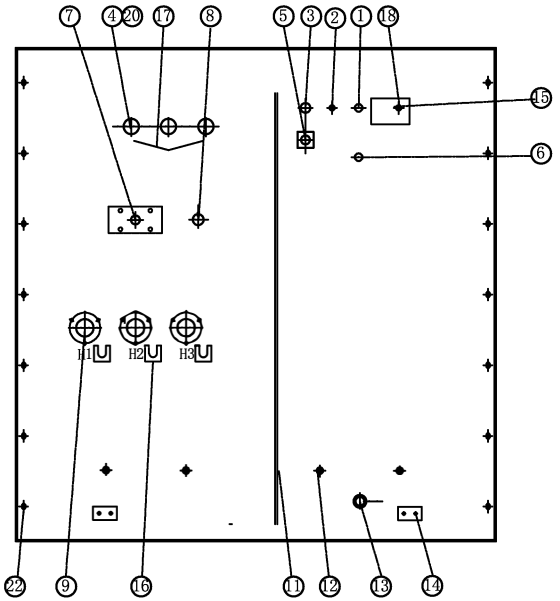


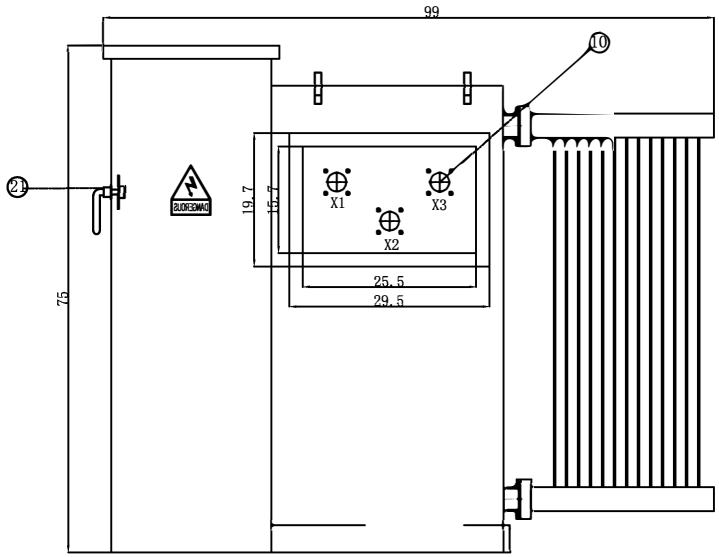

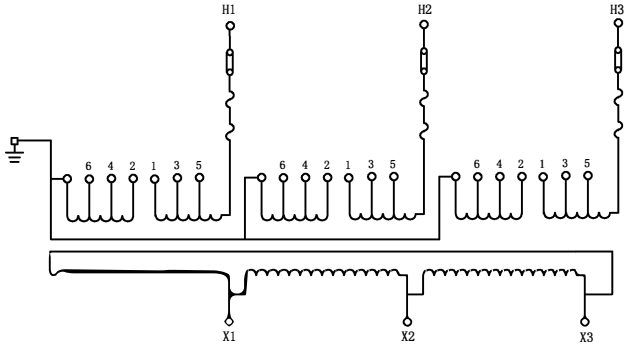

WIRING CONNECTION

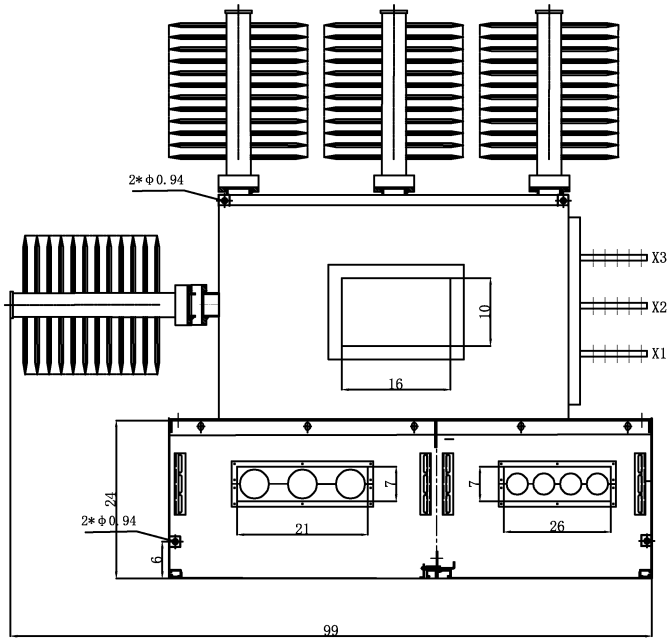

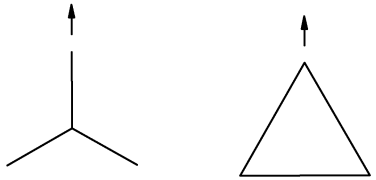

PHASOR DIAGRAM

No.	Name	Model	QTY	Material	Remark
22	tank&housing	coated steel	1	Munsell™ 7.0	GY 3.29/1.5 Bell Green
21	padlock	penta-head bolt	1		
20	current limiting fuse		3		
19	insulation oil	Mineral Oil			
18	gas sample valve		1		Schrade Valve
17	drip shield		1		
16	parking stand		6		
15	nameplate		2		
14	grounding pad	304SS, 2-hole	2		
13	drain valve w/sampler		1		
12	grouding lug	Ø25*20, M10	4		with copper bar
11	reinforcing rib	8mm steel	1		HV/LV barrier
10	LV bushing		3		10-hole spade
9	HV bushing	200A well&insert	3	loadbreak	with (3) arrester
8	off-circuit tap changer		1		
7	load break switch	15KV	3		2-position
6	temperature indicator		1		
5	oil indicator		1		
4	Bayonet fuse		3		w/flapper valve
3	oil fill valve		1		
2	pressure relief valve		1		automatic action
1	pressure indicator		1		

3000kVA, 60Hz, ONAN,
24940GrdY/14400V,
480V, Delta

3P Pad Mounted Transformer

mark	revise	revision	signature	date
designed			standard	
checked			examined	
			approved	

pattern mark | weight | scale

LARSON MAGNETICS

Remark: dimensions here are in inches.Only for approval/preliminary design..

Approx. Weight: 13180LBS.