



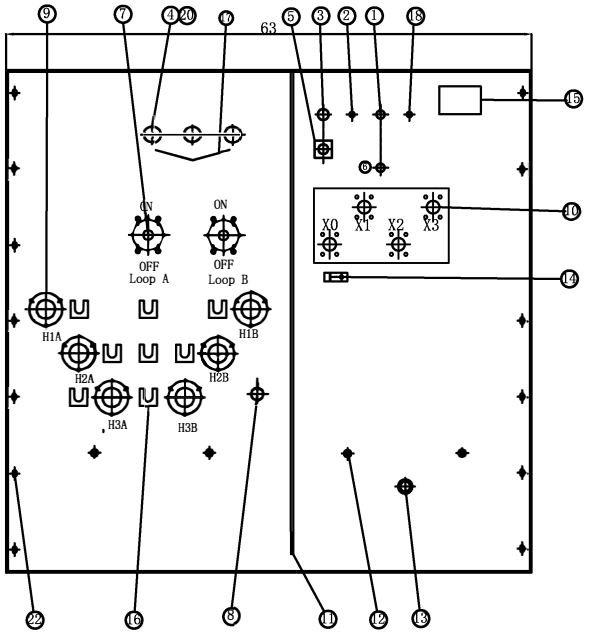


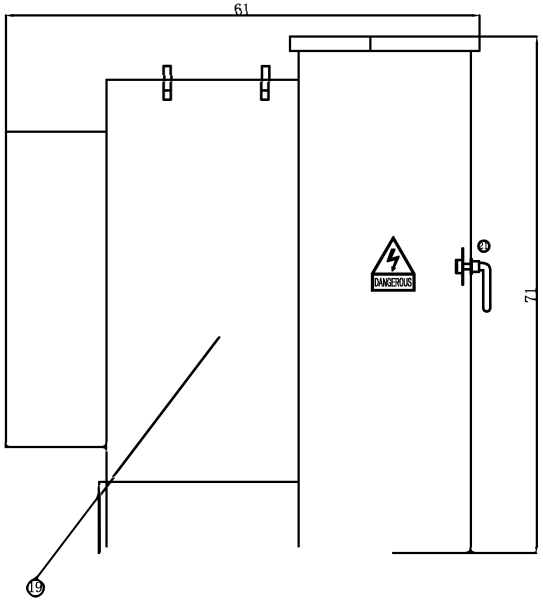

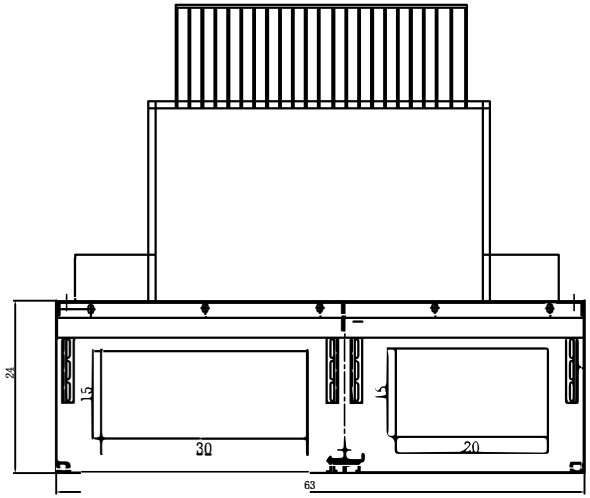

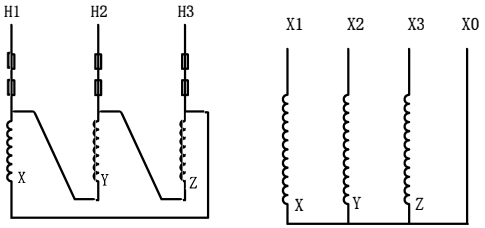

WIRING CONNECTION

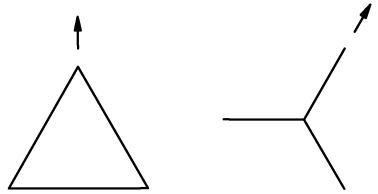

PHASOR DIAGRAM

Remark: dimensions here are in inches.Only for approval/preliminary design..

Approx. Weight: 5300LBS.

No.	Name	Model	QTY	Material	Remark
22	SS hinges&pins				
21	padlock	penta-head bolt	1		
20	current limting fuse	QM-XRNT-80A	3		with Bayonet fuse
19	insulation oil	mineral oil			
18	gas sample valve		1		Schrade Valve
17	drip shield		1		
16	parking stand		8		
15	nameplate		1		
14	grounding strap		1		
13	drain valve w/sampler		1		
12	grouding lug	Ø25*20, M10	4		with copper bar
11	reinforcing rib	8mm steel	1		
10	LV bushing	XTG2-1/630A	4		6-hole spade
9	HV bushing	200A well&insert	6		
8	off-circuit tap changer	WSPⅡ 63/15-5X5	1		
7	load breaker switch	FZF-315, 15KV	2		2 position
6	temperature indicator		1		
5	oil indicator	UHZ-01	1		
4	Bayonet fuse	PRNT-40A	3		w/flapper valve
3	oil fill valve		1		
2	pressure relief valve	YSF	1		automatic action
1	pressure indicator	YZ-70	1		

500kVA, 60Hz, ONAN,
13200V, Delta Pri.
208Y/120V, Wye-N

3P Pad Mounted Transformer

mark	revise	revision	signature	date
designed			standard	
checked			examined	
audited			approved	
crafted			date	

pattern mark | weight | scale

total page | page

LARSON ELECTRONICS